

# EL2P Firmware Release Notes 1.2.7 Rev1.1

# Contents

General.....	3
Tested Application Compatibility .....	3
Released Production Files .....	3
Product Upgrade .....	3
New Features .....	4
New Features added in version 1.2.7.....	4
Resolved Issues .....	5
Outstanding Issues.....	5
New Issues .....	5
Existing Issues .....	6
Release History .....	7

## General

### Tested Application Compatibility

<i>Application</i>	<i>Support</i>	<i>Known Limitations</i>
Security Handle	V4.1	
Web Based LBT		

### Released Production Files

#### Product Upgrade

##### *Image Information*

Filename: pdu-package-1.2.7.bin

Version: 1.2.7

CRC32: 680124B9

SHA256: 41965aec40f77ecb690baa6bbebb5ad0377d61883456e6716a173a56052db0ff

Filesize: 91567327 bytes

# New Features

## New Features added in version 1.2.7

- Initial Release

## Resolved Issues

## Outstanding Issues

### New Issues

The following reported problems have been found since the previous release and are still outstanding in this release.

Issue ID	Title	Version	Status
SUN-826	LDAP and Radius Errors have no event notifications.	v1.1.0	Deferred
SUN-1220	LDAP: testuser not able to login while changing the port to 636	v1.2.5	Deferred
SUN-1229	Status LED blinks Green, beacons stop flashing Yellow when a valid card is swiped when the handle is mechanically unlocked	v1.2.5	Deferred
SUN-1249	configuration upload/download events under incorrect category	v1.2.6	Deferred
SUN-1255	No Event Log entry or SNMP trap when a config is changed on the LCD	v1.2.6	Deferred
SUN-1259	Outlet screen on WebUI missing outlet names and numbers for outlets 43-48	v1.2.5	Deferred

**SUN-826** LDAP and Radius Errors have no event notifications.

LDAP and Radius Errors have no event notifications.

*Workaround:* None.

**SUN-1220** LDAP: testuser not able to login while changing the port to 636

Changing the LDAP port away from the standard port of 389 doesn't work.

*Workaround:* Use port 389

**SUN-1229** Status LED blinks Green, beacons stop flashing Yellow when a valid card is swiped when the handle is mechanically unlocked

When using the Intelligent Rack Handle, if you swipe a card while the handle while the handle is mechanically unlock, the status LED will stop flashing.

*Workaround:* None.

**SUN-1249** configuration upload/download events under incorrect category

The configuration upload and download event are associated with the “Configuration Changed” events instead of the “Configuration File Imported/Exported” events.

*Workaround:* To receive configuration upload and download event enable “Configuration Changed” events.

**SUN-1255** No Event Log entry or SNMP trap when a config is changed on the LCD

When the temperature scale is changed on the LCD screen, the change is not reported to the event log.

*Workaround:* None.

**SUN-1259** Outlet screen on WebUI missing outlet names and numbers for outlets 43-48

When daisy chaining PDUs with different number of outlet, the PDU with less outlets may show show unconnected outlets.

*Workaround:* Ignore the extra outlets.

## Existing Issues

The following reported problems were found prior to the previous release and are still outstanding.

Issue ID	Title	Version	Status

## Release History

Revision	Date	Reason for Change
1.1.3	March 14, 2025	Preliminary Release
1.2.6	June 12, 2025	Maintenance Release
1.2.7	July 11, 2025	Maintenance Release